







NOTICE

- This product is not intended for life or safety applications. Do not install this product in hazardous or classified locations
- Read and understand the instructions before installing this product
- Turn off all power supplying equipment before working on it.
 The installer is responsible for conformance to all applicable codes

If this product is used in a manner not specified by the manufacturer, the protection provided by the product may be impaired. No responsibility is assumed by the manufacturer for any consequences arising out of the use of this material.

PW2 Series

Wet Media Differential Pressure Transducer

Product Overview

The PW2 Series sensor is designed to accept high differential pressure. Install the sensor on a duct or pipe across a pump, filter, heat exchanger, compressor, or other non-corrosive wet media. The dual sensor design eliminates the need for a bypass valve, and the bi-directional capability reduces installation errors. A pushbutton allows easy zero adjustment.

Product Identification

Lo	cal Display	NIST	Operational Range*	CE
PW2	P	\Box		口
	L = LCD Display	N = NIST	03 = 0 to 50 psig	S = Standard
	X = No Display	X = None	04 = 0 to 100 psig	
			05 = 0 to 250 psia	

Select operational range according to maximum gauge pressure, NOT differential pressure. Example: High gauge pressure=90 psig, select 100 psig model (04).

Specifications

Mardia O anno atibilita	47.4 PH 4.14			
Media Compatibility	17-4 PH stainless steel			
Input Power	12 to 24 Vdc, 29 mA max.; loop powered			
Output	2-wire transmitter; 4 to 20 mA (clipped and capped)			
Proof Pressure	2x max. F.S. range			
Burst Pressure	5x max. F.S. range			
Accuracy at 25 °C*	Ranges A, B, C: ±1% F.S.** Range D: ±2% F.S.**			
Surge Damping	Electronic; 5-second averaging			
Temperature Compensated Range	0 to 50 °C (32 to 122 °F); TC Zero <1.5% of product F.S. per sensor TC Span <1.5% of product F.S. per sensor			
Sensor Operating Range	-20 to 85 °C (-4 to 185 °F)			
Long Term Stability	±0.25% per year			
Zero Adjust	Pushbutton auto-zero			
Operating Environment	-10 to 55 °C (14 to 131 °F); 10 to 90% RH non-condensing			
Fittings	1/8" NPT female thread, stainless steel 17-4 PH			
Physical	White powder-coated aluminum			
PRESSURE RANGES				
0 to 50 psi (0 to 3.45 bar)	5/10/25/50 psid (0 to 0.34/0.69/1.72/3.45 bar)			
0 to 100 psi (0 to 6.89 bar)	10/20/50/100 psid (0 to 0.69/1.38/3.45/6.89 bar)			
0 to 250 (0 to 17.24 bar)	25/50/125/250 psid (0 to 1.72/3.45/8.62/17.24 bar)			

Note: To conform to EMC standards, use shielded cabling. Technical information is available from the factory on


^{*} IMPORTANT!

^{*} Accuracy combines linearity, hysteresis, and repeatability.

^{**} F.S. is defined as full span of selected range in bidirectional mode.



Dimensions

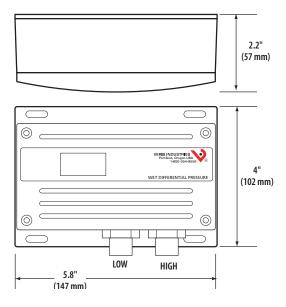


Installation



Observe precautions for handling static sensitive devices to avoid damage to the circuitry that is not covered under the factory warranty.

- 1. Mount sensor on a duct or pipe, across the pump, filter, or other pressure differential.
- 2. Wire as shown below.

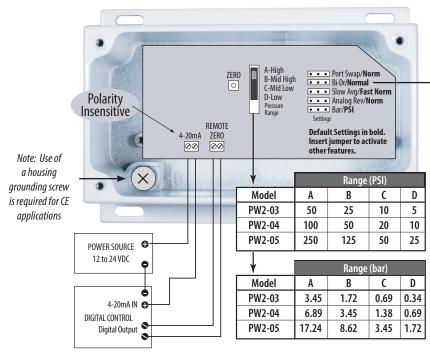

Optional: Connect Zero terminals to digital output (contact closure) of control system.

Bidirectional Operation

LO PORT

0 psi

50 psi

50 psi

100 psi

100 psi

Input Conditions

HI PORT

100 psi

100 psi

50 psi

50 psi

0 psi

Caution: Zero input is for dry-contact only. Do not apply voltage to the Zero terminals.

Result

DP

+100 psi

+50 psi

0 psi

-50 psi

-100 psi

Output is mA only.

Example: PW2-04

Outputs Read

4-20mA

20mA

16mA

12mA

8mA

4mA



Installation (cont.)

3. Configure the jumpers as described below.

Jumper	Notes
Port Swap/Norm	Reverses polarity of the pressure ports (i.e. makes the LO port operate as the HI port and vice versa); used when the sensor is incorrectly plumbed.
Bi-Dr/Normal	Normal: 0 to F.S. pressure Bidirectional: -F.S. pressure to +F.S. pressure; output reads 1/2 when pressure is zero.
Slow Avg/Fast Norm	Slow mode provides 5-second averaging for surge damping.
Analog Rev/Norm	Normal: Output increases as pressure increases; Reverse: Output is maximum when pressure differential is zero and decreases as pressure increases.
Bar/PSI	Select output units.

Operation

Auto-Zero: Press and hold the Zero button for two seconds or provide contact closure on the auxiliary 'Remote Zero' terminal to reset the output to zero pressure. To protect the device from accidental zeroing, this feature is only enabled when the detected pressure is within 5% of factory calibration.